

Land
Survey
Tech

P.O.
Box 713
Beatrice, Ne
68310-0713
JOB - # 1572

SURVEY RECORD

Survey of: The Southeast Quarter of the Northeast Quarter of Section 11, the Southwest Quarter of the Northwest Quarter of Section 12 and a part of the Northeast Quarter of the Northwest Quarter of Section 12 and a part of the Southeast Quarter of the Northwest Quarter of Section 12

Sections 11&12 T. 1 N. R. 1 W. of the 6th P.M.

Thayer County, Nebraska

Date of Survey 7-14-08

Section Corner Description Section 11, T1N, R1W OF 6TH P.M.

NE Cor., Sec. 11-1-1

Found Limestone, 0.75' E-W x 0.25' N-S, 8" deep
w/magnet on top. Also 1"x22" bar, 0.10' N & 0.17' W of
center of stone. Ties are to stone.

39.92'-SE to Mag nail & shiner NE side E gate post
32.64'-SSE to Mag nail & shiner E side W gate post
44.90'-NE to Mag nail & shiner SE side CFP
49.44'-NW to Mag nail & shiner NE side CFP
3'-W to CL road N
-On CL E-W road

N 1/16 Cor., NE 1/4, Sec. 11-1-1

Found $\frac{3}{8}$ " pipe, 22" deep.

47.14'-SE to Mag nail & shiner SW side CFP
47.35'-SW to PK nail & shiner SE side PP
-On CL intersection

N 1/6 Cor., SE 1/4, Sec. 11-1-1

Found Thayer Co. Alum cap., 3" deep.

30.89'-ESE to Mag nail & shiner S side CFP
92.84'-NNW to Mag nail & shiner E side PP
7'-S to fence E
3'-W to CL N-S road

E 1/4 Cor., Sec. 11-1-1

Found Thayer Co. Alum cap., 5" deep.

10.25'-SW to Mag nail & shiner NW side FP
16.21'-ESE to Mag nail & shiner NE side FP
6'-S to E-W fence
1'-N to steel sign post

N 1/4 Cor., Sec. 11-1-1

Found Thayer Co. Alum cap., 10" deep.

44.93'-NE to $\frac{5}{8}$ " rebar w/RM LS638 cap, 11' E of CFP on
high bank
39.44'-SE to $\frac{5}{8}$ " rebar w/RM LS638 cap, in S ROW fence,
S of NE rebar tie
3'-N to CL E-W road

S 1/4 Cor., Sec. 11-1-1

Found Thayer Co. Alum cap., 15" deep.

43.92'-SW to $\frac{5}{8}$ " rebar w/RM LS638 cap, under E-W PP
line & 167' W of PP w/downguy
41.82'-SE to $\frac{5}{8}$ " rebar w/RM LS638 cap, under E-W PP
line & 113' W of PP w/downguy

W 1/4 Cor., Sec. 11-1-1

Found Thayer Co. Alum cap., 18" deep.

2.77'-W to nail & shiner N side CFP
6.88'-SSW to Mag nail & shiner E side brace post
1'-W to green steel sign post

Center 1/16 Cor., NE 1/4, Sec. 11-1-1

Set $\frac{5}{8}$ " rebar w/RM LS638 cap, 3" deep.

33.59'-W to Mag nail & shiner N side CFP
40.40'-SE to Mag nail & shiner SW side brace post
-In line w/E-W fence
-On CL N-S road

E 1/16 Cor., NE 1/4, Sec. 11-1-1

Set $\frac{5}{8}$ " rebar w/RM LS638 cap.

23.77'-NNW to Mag nail & shiner W side E gate post
80.58'-WNW to Mag nail & shiner N side lone post

Section Corner Description Section 12, T1N, R1W OF 6TH P.M.

E 1/4 Cor., Sec. 12-1-1

Found $\frac{3}{8}$ " pipe w/top missing, 6" deep.

39.82'-ENE to Mag nail & shiner S side TUG post
41.00'-NW to Mag nail & shiner top N end CMP
5'-E to CL N-S road

S 1/4 Cor., Sec. 12-1-1

Found Thayer Co. Alum. cap, 1" below surface of asphalt.

18.32'-WSW to Mag nail & shiner top of guard rail post
(9th from W)
19.52'-ESE to Mag nail & shiner top of guard rail post
(15th from W)
12'-N to CL Highway 8

N 1/4 Cor., Sec. 12-1-1

Found $\frac{3}{8}$ " pipe, 2" deep.

118.36'-WSW to Mag nail & shiner N side PP
132.60'-WNW to top SE cor. of end bridge guard rail post
(N side of bridge)
-On CL E-W road

Center 1/16 Cor., NW 1/4, Sec. 12-1-1

Found 12"x8"x3" Limestone. Set $\frac{5}{8}$ " rebar w/LS638 cap, 0.13'
W of stone. Ties are to stone.


0.77'-NW to Mag nail & shiner S side CFP
7.72'-N to Mag nail & shiner E side brace post

N 1/16 Cor., NW 1/4, Sec. 12-1-1

Set $\frac{5}{8}$ " rebar w/RM LS638 cap, 4" deep.

25.24'-NW to Mag nail & shiner SW side E gate post
27.15'-NE to Mag nail & shiner SE side FP(3rd E of GP)
8'-S to CL E-W road
19'-W to fence S

Signed Chris Witulski of July, 2008.

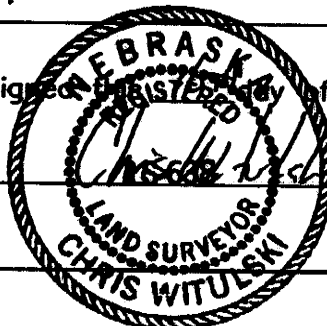

Chris Witulski

882-039 3/3